


1. Approving Civil Aviation Authority/Country FAA/UNITED STATES		2. AUTHORIZED RELEASE CERTIFICATE FAA Form 8130-3, AIRWORTHINESS APPROVAL TAG		3. Form Tracking Number: 6ULGB0001001001	
4. Organization Name and Address: Duncan Aviation/3701 Aviation Road/Lincoln, NE 68524 JGVR194F				5. Work Order/Contract/Invoice Number: 6ULGB	
6. Item: 1	7. Description: BALLSCREW ACTUATOR	8. Part Number: 3272570-6	9. Quantity: 1	10. Serial Number: 3906	11. Status/Work: Repaired
12. Remarks: Customer: WESTERN AIRWAYS Disassembled and cleaned. Visually, dimensionally and NDT inspected. Found annular bearings rough and o-ring worn. No other defects found. One gimbal pin inserted to far removed by machine shop. Replaced all applicable parts with new. Function tested to manufacturers specifications. Repaired IAW HONEYWELL Thrust Reverser Ballscrew Actuator Component Maintenance Manual, Revision 7, dated 01/27/2014. TSN: 23819 CSN: 19472 Duncan Aviation certifies that the work specified in Blocks 11 and 12 was performed IAW EASA part 145, and with respect to that work, the aircraft component is considered ready for release to service under EASA approval number EASA.145.4392. All EASA/FAA Airworthiness Directives are the responsibility of the installer. No current U.S. Airworthiness Directives apply. Technician: Heath Muller This document constitutes a signed copy of the work order Approval for return to service See attached parts list					
13a. Certifies the items identified above were manufactured in conformity to: <input type="checkbox"/> Approved design data and are in a condition for safe operation. <input type="checkbox"/> Non-approved design data specified in Block 12.		14a. <input checked="" type="checkbox"/> 14 CFR 43.9 Return to Service <input checked="" type="checkbox"/> Other regulations specified in Block 12 Certifies that unless otherwise specified in Block 12, the work identified in Block 11 and described in Block 12 was accomplished in accordance with Title 14, Code of Federal Regulations, part 43 and in respect to that work, the items are approved for return to service.			
13b. Authorized Signature:	13c. Approval Authorization No.:	14b. Authorized Signature: 		14c. Approval/Certificate No.: JGVR194F	
13d. Name (Type or Printed):	13e. Date (dd/mm/yyyy):	14d. Name (Type or Printed): Terry J Morrow		14e. Date (dd/mm/yyyy): 13 Nov 2019	
<p align="center">User/Installer Responsibilities</p> <p>It is important to understand that the existence of this document alone does not automatically constitute authority to install the aircraft engine/propeller/article.</p> <p>Where the user/installer performs work in accordance with the national regulations of an airworthiness authority different than the airworthiness authority of the country specified in Block 1, it is essential that the user/installer ensures that his/her airworthiness authority accepts aircraft engine(s)/propeller(s)/article(s) from the airworthiness authority of the country specified in Block 1.</p> <p>Statements in blocks 13a and 14a do not constitute installation certification. In all cases, aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.</p>					



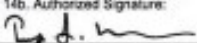

3. Form Tracking Number:

6ULGB0001001001

Parts List

<u>Part Number</u>	<u>Part Description</u>	<u>Serial Number</u>	<u>Quantity</u>
M83248/1-018	ORING		1.000
137-085-5113	BEARING		2.000
3233430-1	BEARING		2.000
3238663-1	GIMBAL PIN		1.000

118006

DUNCAN
AVIATION



Job Detail

Date 11/14/19

Work Order 6ULGB
3701 Aviation Rd.
Lincoln, NE 68524
USA

Desc BALLSCREW ACTUATOR

Part 3272570-6

PO# 270NQ

Modl .

Mfg HONEYWELL

S/N 3906

Ship To Western Airways
200 Jim Davidson Drive
Sugarland Municipal Airport
Sugarland, TX 77498

=====

=P A C K I N G S L I P=

=====

=====

WO #	SHIP DATE	SHIP NO
PNU-6ULGB	11/14/19	6ULGB
FRT PREPAID		
FEDEX GROUND		

=====

CARRIER NOTE

=====

WBJOBDT