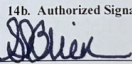


7122 1

RESERVOIR ASSEMBLY
CESSNA P/N: 9912103-3
HTL
SIMI VALLEY, CA
HTL S/N: 9985
HTL- P/N: 212940-2
DATE OF MANUFACTURE: 06/19

1. Approving Civil Aviation Authority/Country: FAA/United States		AUTHORIZED RELEASE CERTIFICATE FAA Form 8130-3, AIRWORTHINESS APPROVAL TAG			3. Form Tracking Number: 25-30638
4. Organization Name and Address: OBrien Enterprises--2420 East 28th Street-Unit 2 Signal Hill CA 90755 (QK3R792L)				5. Work Order/Contract/Invoice Number: HY 27537	
6. Item:	7. Description:	8. Part Number:	9. Quantity:	10. Serial Number:	11. Status/Work:
1	Cylinder and valve assembly	212940-2	1	9985	Inspected
12. Remarks: Inspected in accordance with approved data, CMM 36-10-03, REV 11-2003 Inspect cylinder, hydrostatic test, clean, reinstall and re-torque regulator Other P/N: 9912103-3 Last Hydrostatic test: 10-24-2025 Next hydrostatic test due: 10-24-2028					
13a. Certifies the items identified above were manufactured in conformity to: <input checked="" type="checkbox"/> Approved design data and are in a condition for safe operation. <input type="checkbox"/> Non-approved design data specified in Block 12.			14a. <input checked="" type="checkbox"/> 14 CFR 43.9 Return to Service <input type="checkbox"/> Other regulation specified in Block 12 Certifies that unless otherwise specified in Block 12, the work identified in Block 11 and described in Block 12 was accomplished in accordance with Title 14, Code of Federal Regulations, part 43 and in respect to that work, the items are approved for return to service.		
13b. Authorized Signature: XXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXX		13c. Approval/Authorization No.: XXXXXXXXXXXXXXXXXXXXXXXXXXXX	14b. Authorized Signature: 		14c. Approval/Certificate No.: QK3R792L
13d. Name (Typed or Printed): XXXXXXXXXXXXXXXXXXXXXXXXXXXX		13e. Date (dd/mmm/yyyy): XXXXXXXXXXXXXXXXXXXX	14d. Name (Typed or Printed): Sid OBrien		14e. Date (dd/mmm/yyyy): 24OCT2025
User/Installer Responsibilities					
<p>It is important to understand that the existence of this document alone does not automatically constitute authority to install the aircraft engine/propeller/article.</p> <p>Where the user/installer performs work in accordance with the national regulations of an airworthiness authority different than the airworthiness authority of the country specified in Block 1, it is essential that the user/installer ensures that his/her airworthiness authority accepts aircraft engine(s)/propeller(s)/article(s) from the airworthiness authority of the country specified in Block 1.</p> <p>Statements in Blocks 13a and 14a do not constitute installation certification. In all cases, aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.</p>					

O'Brien Enterprises

2420 E. 28th Street, Suite 2
Signal Hill, California 90755
Tel: 562-988-9546
Email: sobrienenterprises@gmail.com

WORK ORDER NO. **HY** 27537
D.O.T. #B528

HYDROSTATIC TEST FINDINGS AND COMPLETION REPORT

Customer Pius Parts Date Received 10-24-2025
 Address Rockport TX Units Received this P.O. 1
 P.O. # P 00732 Unit 1 of 1 Units. Page 1 of 2 Pages
 Mfg. Part Number 212940-2 Assembly Serial # 9985
 Other Part Number 9912103-3 Cylinder Serial # 79134 B1
 Manufacturer: Valve P/N # _____
 Kidde HTL/PacSci Scott Puritan B/E Tavco Av-Ox Sota Valve(s) Serial # _____
 Aerox Precise Flight ITT _____ Other _____
 Description: 02 Cylinder N2 Cylinder Other _____

REASON FOR RETURN

Hydrostatic Test Other: _____
 Repair _____
 Recharge _____
 Service Regulator _____

INITIAL INSPECTION

Date of Mfg: 04-2019 Size: 90 C.F. TEST PRESSURE 4800 P.S.I.
 Last Hydro: 07-2022 C.I. Other Information: _____
 DOT Rating: _____
 8162-1850 Non-DOT Cylinder
 3AA1800 Other _____ Full
 3HT1850 Empty
 10945-1850
 3AL _____
 Parts Missing: None Safety Cap(s) Valve Fittings 4 Other: _____
 Additional Parts Received: None Safety Caps Strap/Clamp Mask Other: _____
 Exterior Condition: Good Fair Poor Comments: _____
 Interior Inspection: Pass Fail Hidden Damage: None Comments: _____
 Repairable: Yes No BER/Scrap: Yes No
 Serviced per Mfg: HTL/PacSci Kidde DOT/CFR49 Other: _____
 Serviced I.A.W. Customer Procedures Manual: Yes No Manual # 36-10-03 Rev. 11-2003
 Other: _____

CORRECTIVE ACTION

Hydrostatic Test Scope of Work: _____
 Inspect Interior Repaired
 Refinish Ext. Recharge
 Wt. and/or Leak Test No Work Done
 Inspect and Condemn

